


TEMP (°C) 10 15 20 25 30 35 40 45

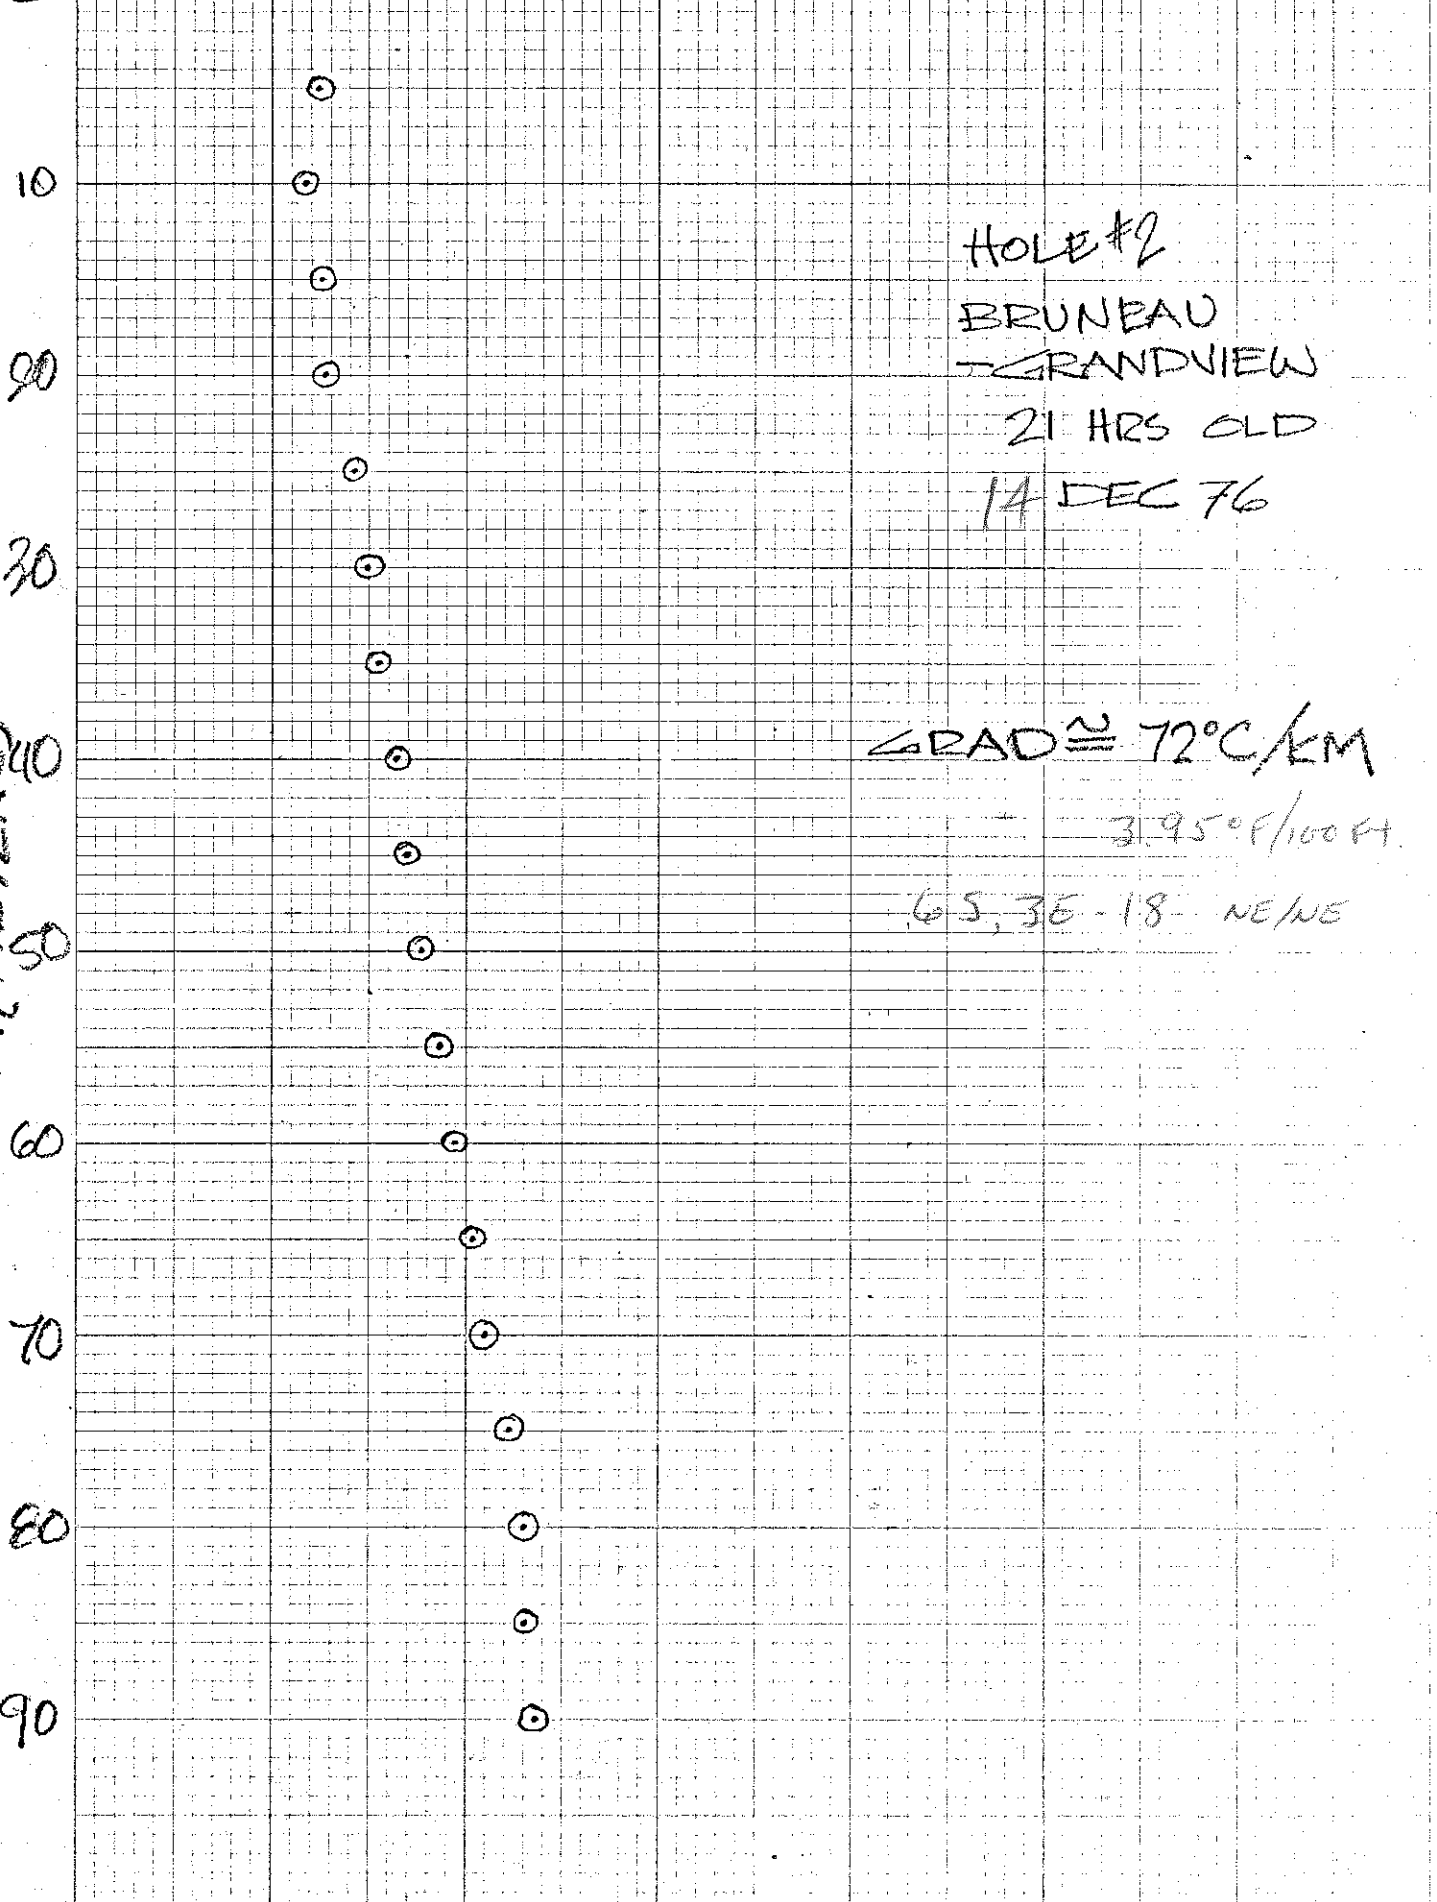

HOLE #2
 BRUNEAU
 GRANDVIEW
 21 HRS OLD
 14 DEC 76

GRAD \approx 72°C/KM
 3.95°F/100 FT
 65, 36-18 NE/NE

\approx 72°C/KM

L. L. RIDGWAY COMPANY, INC. PRINTED IN U.S.A.
 10 DIVISIONS PER INCH BOTH WAYS

T 65 - R 3E - 18 NE of the SE

~~0-25'~~ Earth Power # 2

Lithological Log.

0 - 25' rhyolitic gravel & Qtz sand

25 - 50' clay & gravel

50 - 110' clay

110' - 130' bluish clay - lake bottom

130' - 230' clay

230 - 270' clay & sand

270' - 300' blue clay -

1) Drilling completed at 3:00 PM on 12/18/76

2) completed hole at 5:00 PM on 12/18/76

3) 1/2 hr to install casing.

→ 4) Lost mud circulation at 77'

5) \$8 for hauling water to site

6) Hole measured at 12:00 ~~AM~~ noon on 12/19/76

7) 21 hrs after drilling hole was measured.